


WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

09-716G

BUILDING NO. 328	STREET WEST CEDAR STREET	CITY COMPTON	ZIP 90220	Date of Inspection 07/13/2009	NUMBER OF PAGES 1 of 7
GATEWAY EXTERMINATORS 6076 COMEY AVENUE LOS ANGELES, CA 90034 TEL.# (323) 549 3955 FAX # (323) 549 3957 PR 2866					
Ordered by: PHYLLIS ROCKOWER		Property Owner and/or Party of Interest DODD HARRINGTON TRUST		Report sent to: PHYLLIS ROCKOWER	
COMPLETE REPORT <input checked="" type="checkbox"/>			LIMITED REPORT <input type="checkbox"/>		SUPPLEMENTAL REPORT <input type="checkbox"/>
GENERAL DESCRIPTION: This is a one story, stucco, single family residence. It has a composition roof and was vacant at the time of inspection.			Inspection Tag Posted: Attic. Other Tags Posted:		
An inspection has been made of the structure(s) on the diagram in accordance with the the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.					
Subterranean Termites <input type="checkbox"/> Drywood Termites <input checked="" type="checkbox"/> Fungus/Dryrot <input checked="" type="checkbox"/> Other Findings <input checked="" type="checkbox"/> Further Inspection <input checked="" type="checkbox"/> If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items					
Key: 1 = Substructure 2 = Stall Shower 3 = Foundation 4 = Porchas 5 = Vents 6 = Abutments 7 = Attic 8 = Garage 9 = Patio 10 = Interior 11 = Exterior					

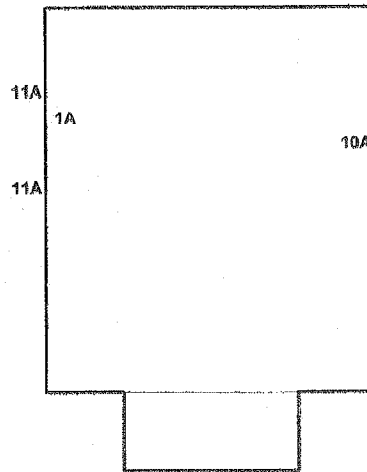

Front of Structure

FOR QUESTIONS OR
 TO SCHEDULE WORK
 PLEASE CALL JUDY
 AT 310 916 8888

Inspected By RENATO G. ESPIRITU License No. FR 27619 Signature

You are entitled to obtain copies of all reports and completion notices on this property report to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 1418 Howe Avenue, Suite 18, Sacramento, California, 95825-3204.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov.

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
328	WEST CEDAR STREET	COMPTON	90220	07/13/2009	2 of 7

NOTES, CAUTIONS AND DISCLAIMERS AREA

THE PEST CONTROL INDUSTRY RECOGNIZES A STRUCTURE TO HAVE CERTAIN AREAS BOTH INACCESSIBLE AND NOT INSPECTED. THESE AREAS INCLUDE BUT ARE NOT LIMITED TO INACCESSIBLE AND/OR INSULATED ATTICS OR PORTIONS THEREOF, ATTICS WITH LESS THAN 18" CLEAR CRAWL SPACE, FLOORING UNDER CARPETS OR CEILING, THE INTERIOR OF HOLLOW WALLS; SPACES BETWEEN A FLOOR OR PORCH DECK AND THE CEILING BELOW; AREAS WHERE THERE IS NO ACCESS WITHOUT DEFACING OR TEARING LUMBER, MASONRY, OR FINISHED WORK; STORAGE, CONDITION, OR LOCKS MAKE INSPECTION IMPRACTICAL AND AREAS OR TIMBERS AROUND EAVES THAT WOULD REQUIRE USE OF AN EXTENSION LADDER.

SLAB FLOOR CONSTRUCTION HAS BECOME MORE PREVALENT IN RECENT YEARS. FLOOR COVERING MAY CONCEAL CRACKS IN THE SLAB THAT WILL ALLOW INFESTATIONS TO ENTER. INFESTATIONS MAY BE CONCEALED BY PLASTER, SHEETROCK OR OTHER WALL COVERINGS SO THAT A DILIGENT INSPECTION MAY NOT UNCOVER THE TRUE CONDITION. THE ROOF WAS NOT INSPECTED DUE TO LACK OF ACCESSIBILITY, QUALIFICATION AND LICENSING. THESE AREAS ARE NOT PRACTICAL TO INSPECT BECAUSE OF HEALTH HAZARDS, DAMAGE, OBSTRUCTION OR INCONVENIENCE AND UNLESS SPECIFIED OR DESCRIBED IN THIS WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT. THIS COMPANY SHALL EXERCISE DUE CARE DURING INSPECTIONS AND TREATMENT BUT ASSUMES NO LIABILITY FOR ANY DAMAGE TO TILES, SLATES, SHINGLES OR OTHER ROOFING MATERIALS, INCLUDING PATIO COVERS, ALUMINUM AWNINGS, SOLAR HEATING, PLANTS, SHRUBERRY OR PAINT DURING ANY TYPE OF TREATMENT.

THIS COMPANY SHALL RECOMMEND FURTHER INSPECTION IF THERE IS ANY QUESTION ABOUT NOTED AREAS. THIS COMPANY WILL NOT REINSPECT UNLESS A BUILDING PERMIT (WHERE APPLICABLE) IS POSTED AND SIGNED VIA: LOCAL BUILDING CODE INSPECTOR. IF A REINSPECTION IS EITHER REQUIRED OR REQUESTED IT MUST BE COMPLETED WITHIN FOUR MONTHS FROM THE DATE OF THE ORIGINAL INSPECTION. THE COST OF A REINSPECTION SHALL NOT EXCEED AND WILL BE THE SAME AS THE COST OF THE ORIGINAL INSPECTION SHALL BE REINSPECTED BY THIS COMPANY PRIOR TO ANY CLOSING OF AREA(S): RE:STRUCTURAL PEST CONTROL ACT ARTICLES 6 SECTION 8516(B), PARAGRAPH 1990(J). AMENDED MARCH 1, 1974.

THE PURPOSE OF THIS REPORT IS TO DOCUMENT FINDINGS AND RECOMMENDATIONS WHICH PERTAIN TO THE ABSENCE OR PRESENCE OF WOOD DESTROYING ORGANISMS AND OR CONDUCIVE CONDITION(S) AT THE TIME OF INSPECTION. THIS REPORT SHOULD BE READ CAREFULLY AND IS NOT TO BE CONFUSED WITH A HOME MAINTENANCE SURVEY. THE CLIENTS COOPERATION AND COMPLIANCE TO CORRECT AND OR COMPLETE THE RECOMMENDATIONS DOCUMENTED IN THIS REPORT ARE OBLIGATORY. WITHOUT A MUTUAL EFFORT THIS COMPANY CAN NOT ASSURE EFFECTIVE OR SATISFACTORY RESULTS.

THE OWNER OF THIS STRUCTURE HAS CERTAIN OBLIGATIONS REGARDING MAINTENANCE AND PERTAINING TO THE DETERRENCE OF WOOD DESTROYING ORGANISMS. MAINTENANCE PROCEDURES INCLUDE; BUT ARE NOT LIMITED TO: REASONABLE CLEANING, UPKEEP OF ROOFS, GUTTERS AND DOWNSPOUTS; PAINTING AND SEALING OF EXPOSED SURFACES; CAULKING ABOUT DOORS AND WINDOWS OR GROUTING ABOUT COMMODES , TUB AND SHOWER ENCLOSURE; STORING MATERIALS ONE FOOT AWAY THE STRUCTURES FOUNDATIONS; PROVIDING ADEQUATE VENTILATION, MAINTAINING PROPER DRAINAGE AWAY FROM STRUCTURE (INCLUDING SPRINKLERS SYSTEMS) ; KEEPING SOIL LEVELS BELOW THE TOP OF FOUNDATIONS AND PROHIBITING EARTH CONTACT WITH WOOD COMPONENTS OF THE STRUCTURE(S).

PREPARATION IS MANDATORY AND IT IS THE OWNERS RESPONSIBILITY TO PROVIDE THE UTILITIES NECESSARY FOR TERMITE WORK. ALL SOIL SHALL BE SOAKED SIX INCHES DEEP AND TWELVE INCHES OUTWARD FROM EXTERIOR FOUNDATIONS ONE DAY PRIOR TO FUMIGATION. ALL PLANTS OR SHRUBERRY MUST BE TRIMMED BACK ONE FOOT FROM STRUCTURE PRIOR TO ANY FUMIGATION OR SUBTERRANEAN TERMITE TREATMENT. ANY STORED MATERIALS, FURNISHINGS, ETC.,ON SLAB FLOORING MUST BE MOVED ONE FOOT AWAY FROM FOUNDATION AND PARTITION WALL INSPECTING AND TREATMENT. THE OWNER MUST ALLOW ACCESS FOR ANY NECESSARY INSPECTION OR TREATMENT.

GUARANTEE POLICY:

THIS GUARANTEE EXCLUDES STRUCTURES WITH SUB SLAB HEATING AIR CONDITIONING SYSTEMS, PLENUM CONSTRUCTION WITH AIR CONDITIONING AND HEATING DUCT IN USE, A WELLOR CISTERIN WITHIN FIFTY FEET AND AREAS THAT ARE INACCESSIBLE FOR TREATMENT. ADDITIONAL EXCLUSIONS INCLUDE STRUCTURES WITH DAMAGE TO OR FROM EXCESSIVE MOISTURE, INADEQUATE CONSTRUCTION, AREAS OF INACCESSIBILITY, DETERIORATING MATERIALS, MASONRY FAILURE, GRADE ALTERATION, PIPES AND CONDUITS BENEATH CONCRETE SLAB, FURNISHINGS OR CONTENTS, ETC. NO GUARANTEE WILL BE ISSUED FOR ANY WORK THAT IS A SECONDARY RECOMMENDATION OR WORK COMPLETED BY OTHERS. GUARANTEED FOR THIRTY DAYS ARE ANY PLUMBING, GROUTING, CAULKING AND RESETTING OF COMMODES SINKS OR ENCLOSURES. ALL OTHER WORK PERFORMED BY THIS COMPANY SHALL BE GUARANTEED FOR THE DURATION OF ONE YEAR.

THIS WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT DOES NOT INCLUDE WORK WHICH REQUIRES CONTACT WITH MATERIALS CONTAINING ASBESTOS. TERMITE INSPECTORS HAVE NO EXPERTISE OR LICENSE IN ASBESTOS ANALYSIS. ASBESTOS IS A NATURAL OCCURING MINERAL FIBER USED EXTENSIVELY IN CONSTRUCTION PRIOR TO 1978. THE OWNER, EMPLOYEE OR CONTRACTOR MUST DETERMINE THE ASBESTOS STATUS PRIOR TO THE COMMENCEMENT OF WORK ON A PROJECT. OCCUPANTS AND EMPLOYEES

BUILDING NO.	STREET	CITY	ZIP	Date of Inspection	NUMBER OF PAGES
328	WEST CEDAR STREET	COMPTON	90220	07/13/2009	3 of 7

MUST BE PROTECTED FROM ASBESTOS FIBER RELEASE. SHOULD ASBESTOS BE OBSERVED DURING ANY CONSTRUCTION OR DEMOLITION. WORK MUST STOP. THE OWNER SHALL OBTAIN THE SERVICES OF AN ASBESTOS ABATEMENT CONTRACTOR TO EVALUATE THE SITUATION, PROVIDE THE NECESSARY SERVICES AND CERTIFY THE AREA SAFE BEFORE WORK MAY ASSUME. ASBESTOS STATEMENT REF: AB2040, SB2572 AND GENERAL INDUSTRY SAFETY ORDER NUMBER 5208.

NOTE: THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION 1 OR SECTION 2 CONDITIONS EVIDENT ON THE DATE OF THIS INSPECTION. SECTION 1 CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION. SECTION 2 ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND. FURTHER INSPECTION ITEMS ARE DEFINES AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION 1 OR SECTION 2.

NOTE: FLOOR AREA WAS COVERED BUT STRUCTURE WAS NOT OCCUPIED AT DATE OF INSPECTION. INTERIOR INSPECTION WAS LIMITED DUE TO OBSTACLES WHICH WOULD BE IMPRACTICAL TO REMOVE AS STATED IN SECTION 1990, PARA. 1. FENCES, PATIO ENCLOSURES, ORNAMENTAL TRELLISES OR DECORATIVE WOOD TRIM ARE NOT INCLUDED OR INSPECTED UNLESS OTHERWISE INDICATED.

NOTE: THIS IS A LIMITED REPORT IN ACCORDANCE WITH SECTION 1994 IN THE STRUCTURAL PEST CONTROL CODE AS THE FOLLOWING WERE THE ONLY AREAS INSPECTED PER OWNER'S WISH.

DISCLAIMERS (CONTINUED)

FOLLOWING AREAS WERE NOT INSPECTED, AS INDICATED IN THE STRUCTURAL PEST CONTROL ACT ART. 6, SEC. 8516(5), PAR. 1990(J), RULES AND REGULATIONS, AS AMENDED ON 03-01-74: FURNISHED INTERIORS, INSULATED AND/OR INACCESSIBLE ATTICS, AND PORTIONS THEREOF; HOLLOWED WALLS, SPACES BETWEEN FLOORS, HIGH DECK AND CEILING OR SOFFIT BELOW; STALL SHOWERS OVER FINISHED CEILINGS; STRUCTURAL SEGMENTS SUCH AS PORTE COCHERES, ENCLOSED BAY WINDOWS, BUTTRESSES AND AREAS TO WHICH THERE IS NO ACCESS WITHOUT DEFACING, TEARING OUT LUMBER, MASONRY AND AREAS THAT REQUIRE USE OF EXPANSION LADDER, FINISHED WORK, BUILT-IN CABINET WORK, FLOORS BENEATH COVERINGS AREAS WHERE STORAGE CONDITIONS OR LOCKS MAKE INSPECTION IMPRACTICAL.

THIS INSPECTION REPORT IS BASED ONLY ON VISIBLE EVIDENCE OF TERMITE OR WOOD-DESTROYING ACTIVITY OR STRUCTURAL DAMAGE. GATEWAY EXTERMINATORS EXPRESSLY DISCLAIMS ANY RESPONSIBILITY OR LIABILITY FOR HIDDEN DAMAGE OR ACTIVITY.

IF A REINSPECTION OF THIS PROPERTY IS REQUESTED BY THE ORIGINAL PERSON ORDERING THE INSPECTION WITHIN FOUR MONTHS, THIS COMPANY WILL MAKE THE INSPECTION AND MAY CHARGE A REINSPECTION FEE. IF RECOMMENDED WORK IS PERFORMED BY SOMEONE OTHER THAN THIS COMPANY, A REINSPECTION OF THE REPAIRS COMPLETED WILL ALSO BE PERFORMED WITHIN FOUR MONTHS OF THE ORIGINAL INSPECTION DATE AND A REINSPECTION FEE WILL BE CHARGED.

OUR CONTRACT DOES NOT INCLUDE DAMAGE TO OR REPLACEMENT OF ANY SHRUBBERY, PLANTS, PAINT, FENCE, POST LINOLEUM, TILE OR ROOFING MATERIAL UNLESS OTHERWISE SPECIFIED.

THIS REPORT IS NOT VALID FOR ESCROW PURPOSES UNLESS WORK IS DONE BY GATEWAY EXTERMINATORS. HOWEVER, SHOULD THIS REPORT INDICATE NO FINDINGS OR RECOMMENDATIONS, THIS CERTIFICATION AS ISSUED IS VALID.

IT IS THE RESPONSIBILITY OF THE OWNER AND/OR REAL ESTATE AGENT/BROKER TO PROPERLY NOTIFY TENANTS OR OTHER OCCUPANTS OF ABOVE SUBJECT REGARDING WORK TO BE DONE AND THE CHEMICALS TO BE USED AS STATED IN THIS STANDARD INSPECTION REPORT.

W/B ZINC TREAT	VIKANE	CYKICK
Water borne Wood Preservative	GAS FUMIGANT	ACTIVE INGREDIENTS
ACTIVE INGREDIENTS	ACTIVE INGREDIENTS	cyfluthrin.....1.0%
Zinc Nathenate.....15.7%	Sulfuryl Flouride...99.0%	Other Ingredients.....99.9%
(Inc. as Metal, 2%)	Inert Ingredients...1.0%	EPA Reg. # 499-470

THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION I OR SECTION II. CONDITIONS EVIDENT ON THE DATE OF THIS INSPECTION SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTON OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTON. SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTON BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND. FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR SECTION II.

PERFORM.
 RESPONSIBLE FOR ANY ACT OR OMISSION IN THE PERFORMANCE OF WORK THAT YOU DIRECTLY CONTRACTED WITH ANOTHER TO IF YOU CHOOSE TO CONTRACT DIRECTLY WITH ANOTHER REGISTERED COMPANY, GATEWAY EXTERMINATORS WILL NOT IN ANY WAY BE REGISTERED COMPANY, LICENSED TO PERFORM THE WORK.
 PAYING THE SUB-CONTRACTOR. YOU MAY ACCEPT GATEWAY EXTERMINATORS BID OR YOU MAY CONTRACT DIRECTLY WITH ANOTHER REGISTERED COMPANY, LICENSED TO PERFORM THE WORK.
 THE CHARGE FOR SERVICE THAT THIS COMPANY SUBCONTRACTS TO ANOTHER REGISTERED COMPANY MAY INCLUDE THE COMPANY'S CHARGES FOR ARRANGING AND ADMINISTERING SUCH SERVICES THAT ARE IN ADDITION TO THE DIRECT COSTS ASSOCIATED WITH REGISTERED COMPANY, LICENSED TO PERFORM THE WORK.
 FROM COMPANY TO COMPANY. YOU HAVE THE RIGHT TO SEEK A SECOND OPINION FROM ANOTHER COMPANY.
 REPORTS ON THIS STRUCTURE PREPARED BY VARIOUS REGISTERED COMPANIES SHOULD LIST THE SAME FINDINGS (I.E. TERMITE INFESTATIONS, TERMITE DAMAGE, FUNGUS DAMAGE, ECT.), HOWEVER, RECOMMENDATIONS TO CORRECT THESE FINDINGS, MAY VARY FROM COMPANY TO COMPANY.

THIS REPORT DOES NOT CONTAIN ANY WARRANTIES, EXPRESSED OR IMPLIED AS TO THE HIDDEN PRESENCE OF WOOD DESTROYING INSECTS AND/OR ORGANISMS AND ANY DAMAGE FROM THE SAME.

NO OPINION IS RENDERED BY GATEWAY EXTERMINATORS CONCERNING THE CONDITION AND/OR WATER TIGHT INTEGRITY OF THE ROOF AND/OR THE PLUMBING CONDITIONS (HIDDEN OR OTHERWISE) IN ALL STRUCTURES OF THE PROPERTY. SHOULD ENGAGE THE SERVICES OF A LICENSED CONTRACTOR, SINCE THIS IS NOT WITHIN THE SCOPE OF OUR LICENSE.

THE EXTERIOR SURFACE OF THE ROOF WAS NOT INSPECTED. IF YOU WANT THE WATER TIGHTNESS OF THE ROOF DETERMINED, YOU SHOULD CONTACT A ROOFING CONTRACTOR WHO IS LICENSED BY THE CONTRACTOR'S STATE LICENSED BOARD.

TERMIDOR	TIMBOR	DRAGNET
Fipronil..... 9.1%	Disodium Octaborate.....98%	ACTIVE INGREDIENTS
Inert Ingredients.....90.9%	Inert Ingredients.....2%	Permethrin.....36.8%
EPA Reg. # 432-901	EPA Reg. # 64405-8	EPA Reg. #279-3062
COPPER NAPHTHENATE	TALSTAR	ACTIVE INGREDIENTS
Copper Naphthenate.....20.0%	Bifenthrin.....7.9%	Inert Ingredients.....63.2%
Inert Ingredients.....80.0%	Inert Ingredients..92.1%	EPA Reg. #279-3062

07/16/2009 15:14	3235493957	GATEWAY EXT	PAGE 05/08
BUILDING NO.	CITY	ZIP	NUMBER OF PAGES
328	COMPTON	90220	4 of 7
WEST CEDAR STREET	DATE OF INSPECTION	07/13/2009	

1. SUBSTRUCTURE AREA

ITEM NO. 1A

FINDING:

PLUMBING LEAK WAS NOTED IN THE SUBAREA AS INDICATED ON THE DIAGRAM.

(Section 2)

RECOMMENDATION: 1A

OWNER TO EMPLOY PLUMBER OR WATER PROOFING COMPANY TO INSPECT AND CONDUCT NECESSARY REPAIRS.

7. ATTIC AREA

ITEM NO. 7A

FINDING:

A COMPLETE AND THOROUGH INSPECTION OF THE ATTIC AREA COULD NOT BE MADE DUE TO INSULATION, HOWEVER, EVIDENCE OF KALOTERME (DRYWOOD TERMITES) NOTED AS INDICATED ON THE DIAGRAM.

(Section 1)

10. INTERIOR AREA

ITEM NO. 10A

FINDING:

A POTENTIAL EXCESSIVE MOISTURE CONDITION WAS FOUND AT THE LOOSE TOILET WHICH IS DEEMED LIKELY TO LEAD TO FUNGUS AND DRY ROT CONDITIONS. (NO EXCESSIVE MOISTURE WAS FOUND AT THE TIME OF INSPECTION).

(Section 2)

RECOMMENDATION: 10A

REPLACE WAX SEAL AND BOLT DOWN TOILET TO ELIMINATE THE POTENTIAL EXCESSIVE MOISTURE CONDITION. HOWEVER, UPON REMOVAL OF TOILET SEAT AND DRY ROT OR SURFACE FUNGUS IS DISCOVERED, THE OWNER/REPRESENTATIVE WILL BE FIRST INFORMED OF THE SITUATION AND A SUPPLEMENTAL TERMITE REPORT AND PRICE QUOTATION WILL BE CREATED PRIOR TO CONTINUANCE OR COMPLETION OF CONTRACTED WORK BY THIS COMPANY.

11. EXTERIOR AREA

ITEM NO. 11A

FINDING:

DRY ROT NOTED AT RAFTER TAIL AS INDICATED ON THE DIAGRAM.

(Section 1)

RECOMMENDATION: 11A

CHEMICALLY TREAT INFESTED TIMBERS USING DISODIUM OCTABORATE TETRAHYDRATE (TIM-BOR) OR CYKICK (CYFLUTHRIN) AS THE METHOD OF CONTROL FOR KALOTERME (DRYWOOD) TERMITES INFESTATION. (LOCAL TREATMENT IS NOT INTENDED TO BE AN ENTIRE STRUCTURE TREATMENT METHOD. IF INFESTATIONS OF WOOD-DESTROYING PESTS EXTEND OR EXIST BEYOND THE AREA(S) OF LOCAL TREATMENT, THEY MAY NOT BE EXTERMINATED.)

ITEM NO. 11B

NOTE:

EXTERIOR INSPECTION OF THE WAS LIMITED DUE TO LOCKED GATE AT THE TIME OF INSPECTION.

ITEM NO. 11C

EXTERMINATING CO.

THIS PROPERTY WAS FUMIGATED ON OR ABOUT 02/13/2009 BY NORDHAGEN AND DAUGHTERS

BUILDING NO.	328	STREET	WEST CEDAR STREET	CITY	COMPTON	ZIP	90220	Date of Inspection	07/13/2009	NUMBER OF PAGES	5 of 7
--------------	-----	--------	-------------------	------	---------	-----	-------	--------------------	------------	-----------------	--------