

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 3433	Street ELMWOOD COURT	City RIVERSIDE	Zip 92501	Date of Inspection 10/02/08	Number of Pages 4
----------------------	-------------------------	-------------------	--------------	--------------------------------	----------------------



P.O. Box 6233
San Bernardino, CA 92412
909-885-9954 FAX 909-885-7459
PR 0808

Ordered by: GRESHAM SAVAGE 3750 UNIVERSITY AVENUE #20 RIVERSIDE CA 92501 Rec: 8265 Rpt: JH8265	Property Owner and/or Party of Interest: MR. FIRETAG 3433 ELMWOOD COURT RIVERSIDE CA 92501	Report sent to: MR. FIRETAG 3433 ELMWOOD COURT RIVERSIDE CA 92501 Esc: 1
---	--	---

COMPLETE REPORT
 LIMITED REPORT
 SUPPLEMENTAL REPORT
 REINSPECTION REPORT

General Description: 1 story single family residence unfurnished and vacant	Inspection Tag Posted: Attic Other Tags Posted: None
--	---


An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites
 Drywood Termites
 Fungus / Dryrot
 Other Findings
 Further Inspection

If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

8A

DIAGRAM NOT TO SCALE

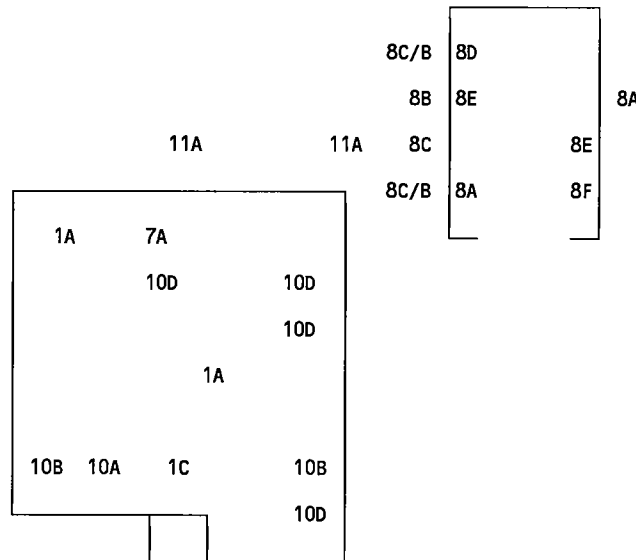

FRONT

Inspected by: HALE, JASON **State License No.:** FR16652 **Signature:**

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 1418 Howe Avenue, Suite 18, Sacramento, California, 95825-3204.
 NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916)561-8708, (800) 737-8188 or www.pestboard.ca.gov.

PAGE 2 OF WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Address of property inspected: Bldg. No: 3433 Street: ELMWOOD COURT
Date of Inspection: 10/02/08

City: RIVERSIDE

"NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.) However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company."

"NOTICE: The charge for service that this company subcontracts to another registered company may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor. You may accept Antimite's bid or you may contract directly with another registered company licensed to perform the work. If you choose to contract directly with another registered company, Antimite will not in any way be responsible for any act or omission in the performance of work that you directly contract with another to perform."

This is a "Wood Destroying Pests and Organisms Report" required by most mortgage lenders for escrow. This is not a "Pest Control Report" which includes such common non-wood destroying pests such as rats, mice, ants, cockroaches, silverfish, fleas, etc.

IMPORTANT - PLEASE READ CAREFULLY

Under no circumstance should this wood destroying pest and organisms inspection report be construed as a guaranty and/or warranty of the structure(s). Inspection reports are intended to disclose infestations, infections and/or conducive conditions which are noted on the date of inspection in the visible and accessible areas only, as required by the Structural Pest Control Act. Any infestation, infection, and/or conducive condition which is found after the date of inspection by any other person(s) will require an additional inspection report with findings, recommendations, and estimates.

A. Certain areas are recognized by the industry as inaccessible and/or for other reasons not inspected. These include but are not limited to: inaccessible and/or insulated attics or portions thereof, attics with less than 18" clear crawl space; the interior of hollow walls; spaces between a floor or porch deck and the ceiling below; areas where there is no access without defacing or tearing out lumber, masonry or finished work; areas behind stoves, refrigerators or beneath floor coverings, furnishings; areas where encumbrances and storage, conditions or locks make inspection impractical; and areas or timbers around eaves that would require the use of an extension ladder. Unless otherwise specified in this report, we do not inspect fences, sheds, dog houses, detached patios, detached wood decks, wood retaining walls or wood walkways.

B. Slab floor construction has become more prevalent in recent years. Floor coverings may conceal cracks in the slab that will allow infestation to enter. Infestations in the walls may be concealed by plaster so that a diligent inspection may not disclose the true condition. These areas are not practical to inspect because of health hazards, damage to the structure, or inconvenience. They were not inspected unless described in this report. We recommend further inspection if there is any question about the above noted areas. Ref: Structural Pest Control Act, Article 6, Section 8516(b) paragraph 1990(i). Amended effective March 1, 1974. Inspection is limited to disclosure of wood destroying pests or organisms as set forth in the Structural Pest Control Act, Article 6, Section 8516(b), Paragraph 1990-1991.

C. This inspection pertains only to the specific address or addresses indicated above and does not include any attached or adjacent unit(s).

D. Local treatment is not intended to be an entire structure treatment method. If infestations of wood-destroying pests extend or exist beyond the area(s) of local treatment, they may not be exterminated.

E. This company is not responsible for work completed by others, recommended or not, including by Owner. Contractor bills should be submitted to Escrow as certification of work completed by others.

F. The exterior surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

G. This proposal does not include Painting or Decorating in the process of work performed. Items recommended will be replaced as close as possible to original but are not guaranteed to match.

H. Second story stall showers are inspected but not water tested unless there is evidence of leaks in ceilings below. Ref: Structural Pest Control Rules and Regulations, Sec. 8516G. Sunken or below grade showers or tubs are not water tested due to their construction.

I. During the course of/ or after opening walls or any previously concealed areas, should any further damage or infestation be found, a supplemental report will be issued. Any work completed in these areas would be at Owner's direction and additional expense.

J. During the process of treatment or replacement it may be necessary to drill holes through ceramic tiles or other floor coverings; these holes will then be sealed with concrete. We will assume no responsibility for cracks, chipping or other damage to floor coverings. We do not re-lay carpeting.

K. We assume no responsibility for damage to any Plumbing, Gas or Electrical lines that occurs process of pressure treatment of concrete slab areas or replacement of concrete or structural timbers, or any resulting damage from damage to these lines.

L. When a fumigation is recommended we will assume no responsibility for damage to SHRUBBERY, TREES, PLANTS, TV ANTENNAS or ROOFS. A FUMIGATION NOTICE will be left with, or mailed to the Owner of this property, or his designated Agent which states, among other things, that ALL FOOD AND MEDICINES must be removed from premises or placed in approved sealed bags PRIOR to fumigation. Antimite does not provide on-site security and does not assume any responsibility in case of vandalism, breaking or entering. The possibility of burglary exists as it does any time you leave your home; therefore, we recommend that you take any steps that you feel are necessary to prevent any damage to your property.

Initials _____

PAGE 3 OF WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Address of property inspected: Bldg. No: 3433 Street: ELMWOOD COURT City: RIVERSIDE
Date of Inspection: 10/02/08

M. Your termite report and clearance will cover any EXISTING infestation or infection which is outlined in this report. If Owner of property desires coverage of any new infestation it would be advisable to obtain a Control Service Agreement which would cover any new infestation for the coming year.

N. If you should have any questions regarding this report, please call or come by our office any weekday between 8:00 am and 5:00 pm. We also provide additional services for the control of Household Pests such as Ants and Fleas etc.

O. I agree to pay reasonable attorney's fees if suit is required by this company to enforce any terms of this contract, together with the costs of such action, whether or not suit proceeds to judgment.

P. The total amount of this contract is due and payable upon completion of work unless otherwise specified. A finance charge computed at a monthly rate of 1.5% of the unpaid balance (annual percentage rate of 18%) will be added to all accounts past due.

Q. If this report is used for escrow purposes then it is agreed that this inspection Report and Completion, if any, is part of the ESCROW TRANSACTION. If this work is to be billed to an escrow company, you will be responsible for payment within 30 days if escrow should be unusually prolonged, closes, or is cancelled without payment being made for all costs incurred by this company.

R. Should any party in interest desire further information pertaining to the condition of the PLUMBING or ROOF, we recommend the employment of a licensed contractor, as this is not within the scope of our license and we do not issue certifications in these areas.

S. This Wood Destroying Pests and Organisms Report DOES NOT INCLUDE MOLD or any mold like condition. No reference will be made to mold or mold like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by The Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each inspection. The reinspection must be done within ten working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

WORK AUTHORIZATION

Signature hereby acknowledges that this obligation took place in the city of San Bernardino, State of California.

Items authorized: _____ Total Cost: _____ Date Signed : _____

Accepted by: _____ Property Address _____

Printed Name: _____

NOTICE TO OWNER

Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid. To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". Prime contractors and laborers for wages do not have to provide this notice. A preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

"State law requires that you be given the following information:CAUTION - PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the State finds that based on existing scientific evidence there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized." " If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or Poison control center (800) 876-4766 and your pest control company immediately."

"For further information contact any of the following: ANTIMITE (800)351-5588; for Health Questions: County Health Department - Orange (714)834-3155; Los Angeles (323)881-4046; Riverside (951)358-5000; San Bernardino (909)884-4056; San Diego (858)694-2888; Santa Barbara (805)681-4900; Ventura (805)654-2813; Kern (661)862-8700. For application information: County Agriculture Commission - Orange (714)447-7100; Los Angeles (626)575-5471; Riverside (951)955-3000; San Bernardino (909)387-2105; San Diego (858)694-2739; Santa Barbara (805)681-5600; Ventura (805)933-8415; Kern (661)868-6300; and for Regulatory Information: Structural Pest Control Board: 1418 Howe Avenue, Suite 18, Sacramento, CA 95825-3280, (800)737-8188."

One of the following may be used on your property:
DRAGNET SFR(Permethrin) VIKANE(Sulfuryl Fluoride) TERMIDOR SC(Fipronil) CHLOROPICRIN PREMISE 75(Imidacloprid)
WASP & HORNET JET FREEZE(Pyrethrins) OTHER _____
(rev 9/06)

PAGE 4 OF WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Address of property inspected: Bldg. No: 3433 Street: ELMWOOD COURT
Date of Inspection: 10/02/08

City: RIVERSIDE

- | | |
|-------------------------|--|
| 1. SUBSTRUCTURE AREA: | Dry-Partially accessible - See #1. |
| 2. SHOWER: | None -2nd story none |
| 3. FOUNDATIONS: | Concrete |
| 4. PORCHES: | Concrete earth filled |
| 5. VENTILATION: | Adequate above grade |
| 6. ABUTMENTS: | None |
| 7. ATTIC SPACES: | Insulated 20% accessible See #7. |
| 8. GARAGES: | Detached 50% access -storage/constr. See #8. |
| 9. PATIOS AND/OR DECKS: | PATIOS: None |
| 10. INTERIOR: | Interior: see #10. |
| 11. EXTERIOR: | Exterior: see #11. |

Notes: (A) Annual pest control service is offered at a cost of \$ 385.00

. Antimite also offers one time pest services to prepare your property for sale. Please call for your discounted price.

IMPORTANT NOTE: Pages 2 and 3 of our inspection report state our terms, conditions and limitations.

PRICES QUOTED ARE VALID ONLY WHEN ALL WORK IS PERFORMED BY THIS COMPANY.

ANY REPAIRS OR TREATMENTS PERFORMED BY THIS COMPANY ARE WARRANTED FOR ONE YEAR, UNLESS OTHERWISE STATED IN THIS CONTRACT.

SUBSTRUCTURE AREA

- 01A. FINDING: INACCESSIBLE AREA(S) MARKED 01A ON DIAGRAM DUE TO INADEQUATE CLEARANCE NOTED IN SUBSTRUCTURE.
RECOMMENDATION: LOWER SOIL IN SUBAREA TO OBTAIN A MINIMUM OF 12 INCHES CLEARANCE BETWEEN BOTTOM OF FLOOR JOIST AND UNIMPROVED SOIL AREA. AFTER THE SOIL IS LOWERED ANTIMITE WILL RE-INSPECT AND ISSUE A SUPPLEMENTAL REPORT OF ANY NEW FINDINGS.
- 01B. FINDING: EVIDENCE OF DRYWOOD TERMITES NOTED IN AREA(S) MARKED 01B ON DIAGRAM, EXTENDING INTO INACCESSIBLE AREAS.
RECOMMENDATION: SEE RECOMMENDATION 10A BELOW FOR COSTS AND OTHER INFORMATION.
- 01C. FINDING: EARTH TO WOOD CONTACT NOTED AT EARTH FILLED PORCH, MARKED 01C ON DIAGRAM.
RECOMMENDATION: INSTALL MASONRY SEAL BETWEEN EARTH FILL AND ADJACENT WOOD STRUCTURE MEMBERS.TREAT PORCH FILL BEFORE SEALING.
Please see important note D on page 2 of this report.

ATTIC SPACES

- 07A. FINDING: EVIDENCE OF ROOF LEAK(S) NOTED IN AREA(S) MARKED 07A ON DIAGRAM.
RECOMMENDATION: REPAIR ROOF LEAKS. REPAIRS TO BE MADE BY OTHERS.

GARAGES

- 08A. FINDING: INACCESSIBLE AREA(S) MARKED 08A ON DIAGRAM.
RECOMMENDATION: IF INSPECTION OF AREA(S) AT INTERIOR OF GARAGE AT NORTH AND EAST SIDES IS REQUIRED, IT MUST BE MADE ACCESSIBLE. ANTIMITE WILL THEN RE-INSPECT AND ISSUE A SUPPLEMENTAL REPORT OF OUR NEW FINDINGS. ANTIMITE RECOMMENDS FURTHER INSPECTION OF THIS AREA.
- 08B. FINDING: FUNGUS DAMAGED WOOD NOTED IN EAVES MARKED 08B ON DIAGRAM.
RECOMMENDATION: REPLACE FUNGUS DAMAGED WOOD AT 2 X 4 RAFTER TAILS AND 1 X 4 ROOF SHEATHING
PRIMER AND FINISH PAINTING IS NOT INCLUDED IN THIS ESTIMATE.

PAGE 5 OF WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Address of property inspected: Bldg. No: 3433 Street: ELMWOOD COURT
Date of Inspection: 10/02/08

City: RIVERSIDE

08C. FINDING: EVIDENCE OF ROOF LEAK(S) NOTED IN AREA(S) MARKED 08C ON DIAGRAM.
RECOMMENDATION: REPAIR ROOF LEAKS. REPAIRS TO BE MADE BY OTHERS.

08D. FINDING: EVIDENCE OF DRYWOOD TERMITES NOTED IN AREA(S) MARKED 08D ON DIAGRAM.
RECOMMENDATION: SEE RECOMMENDATION 10A BELOW FOR COSTS AND OTHER INFORMATION.

08E. FINDING: TERMITE DAMAGED WOOD NOTED AT AREA(S) MARKED 08E ON DIAGRAM.
RECOMMENDATION: REPLACE TERMITE DAMAGE AT 2 X 4 FRAMING PRIMER AND FINISH PAINTING IS NOT INCLUDED IN THIS ESTIMATE.

08F. FINDING: EVIDENCE OF SUBTERRANEAN TERMITES NOTED IN AREA(S) MARKED 08F ON DIAGRAM.
RECOMMENDATION: TREAT AREA(S) AT SOUTH EAST CORNER OF GARAGE
FOR THE CONTROL OF SUBTERRANEAN TERMITES. REMOVE OR DESTROY TERMITE TUNNELS. AREAS TREATED
ARE WARRANTED FOR ONE YEAR. Please see important note D on page 2 of this report.

INTERIOR

10A. FINDING: EVIDENCE OF DRYWOOD TERMITES NOTED IN AREA(S) MARKED 10A ON DIAGRAM, EXTENDING INTO INACCESSIBLE AREAS.
RECOMMENDATION: COVER HOUSE AND GARAGE AND FUMIGATE FOR THE ELIMINATION OF DRYWOOD TERMITES. COVER OR REMOVE ACCESSIBLE TERMITE
PELLETS.

10B. FINDING: OLD TERMITE DAMAGED WOOD NOTED IN AREA(S) MARKED 10B ON DIAGRAM.
RECOMMENDATION: OWNER TO HAVE AREA(S) AT HARDWOOD FLOORING AT SIDE DOOR
INSPECTED BY QUALIFIED TRADESMAN AND REPAIRED OR REPLACED AS MAY BE DEEMED
NECESSARY.

10C. FINDING: FUNGUS DAMAGED WOOD NOTED AT AREA(S) MARKED 10C ON DIAGRAM.
RECOMMENDATION: SEE RECOMMENDATION 10B ABOVE FOR COSTS AND OTHER INFORMATION.

10D. FINDING: WATER STAINS AND/OR DAMAGE NOTED IN AREA(S) MARKED 10D ON DIAGRAM.
RECOMMENDATION: OWNER TO HAVE AREA(S) AT HALL BATH WALLS, HALL BATH CEILING BEDROOM CEILINGS AND CLOSET CEILING
INSPECTED BY QUALIFIED TRADESMAN AND REPAIRED OR REPLACED AS MAY BE DEEMED
NECESSARY.

EXTERIOR

11A. FINDING: EVIDENCE OF ROOF LEAK(S) NOTED IN AREA(S) MARKED 11A ON DIAGRAM.
RECOMMENDATION: SEE RECOMMENDATION 7A ABOVE FOR COSTS AND OTHER INFORMATION.

ADDITIONAL NOTES:

Prior to fumigation, all trees, bushes, plants and vegetation must be trimmed to a minimum of 12 inches from
the perimeter of the structure being fumigated.

When a property is fumigated, the roof surfaces and perimeter areas of the building must be walked on by our crew
in order to put the tarps in place, and damage may occur to certain types of roofs.

Fumigation is warranted for a period of two (2) years.

TOTAL COST: \$1740.00 = Inspection fee: \$0.00 + Item #'s:(01A) Bid will be given upon request.
(01B) See recommendation 10A for price.
(01C) Bid will be given upon request. (07A) No bid. Work is to be completed by others.

PAGE 6 OF WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Address of property inspected: Bldg. No: 3433 Street: ELMWOOD COURT

City: RIVERSIDE

Date of Inspection: 10/02/08

- (08A) Further inspection is recommended. (08B) No bid. Work is to be completed by others.
(08C) No bid. Work is to be completed by others. (08D) See recommendation 10A for price.
(08E) No bid. Work is to be completed by others. (08F)\$ 350.00 (10A)\$ 1,390.00
(10B) No bid. Work is to be completed by others. (10C) See recommendation 10B for price.
(10D) No bid. Work is to be completed by others. (11A) See recommendation 7A for price.

Your Bugs our Business

SAVE! 50%

Please ask for the name that appears on this card.

• Fast Escrow Service •

Fax # (909) 885-7459

Discount #381

ANTIMITE

Since 1941

TERMITE and PEST CONTROL

www.antimite.net

Jason Hale

District Manager

State License #FR-016652

Cellular # (909) 322-5089

(951) 683-2099

(951) 247-1352

(909) 482-5076

(909) 825-8613, Ext. 134

ANT-4067 (10/07)